


WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
	Connecticut Street	San Francisco, CA	94107	8-14-06	10
<p>DIVERSE INSPECTION SERVICES, INC. P.O. BOX 460447 SAN FRANCISCO, CA 94146-0447 Tel: (415) 665-8288 Fax: (415) 643-8729 Report #066730T</p>					
Ordered by:		Property Owner and/or Party of Interest:		Report sent to:	
<div style="font-size: 48px; opacity: 0.3; pointer-events: none;">SAMPLE COPY ONLY!</div>					
COMPLETE REPORT <input checked="" type="checkbox"/> LIMITED REPORT <input type="checkbox"/> SUPPLEMENTAL REPORT <input type="checkbox"/> REINSPECTION REPORT <input type="checkbox"/>					
General Description: The above property is a three-story, two-level, two-unit building over a garage/basement/slab. The structure has a wood and masonry exterior. It is attached to the neighbor's. The structure faces in a westerly direction. At the time of this inspection, it was occupied and furnished.				Inspection Tag Posted: In the passageway. Other Tags Posted: JK Control, Inc. 6-19-2006	
An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected. The drawing is not to scale. Items don't depict scope/amount of work.					
Subterranean Termites <input type="checkbox"/> Drywood Termites <input type="checkbox"/> Fungus / Dryrot <input checked="" type="checkbox"/> Other Findings <input checked="" type="checkbox"/> Further Inspection <input checked="" type="checkbox"/> If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.					

Estimated Costs for items:

- 1) Deferred to Owner
- 2) \$375.00
- 3) \$5,350.00
- 4) \$1,375.00
- 5) \$1,650.00
- 6) \$3,250.00
- 7) \$650.00
- 8) \$2,500.00
- 9) \$7,300.00
- 10) \$925.00

Permit fee
\$850.00

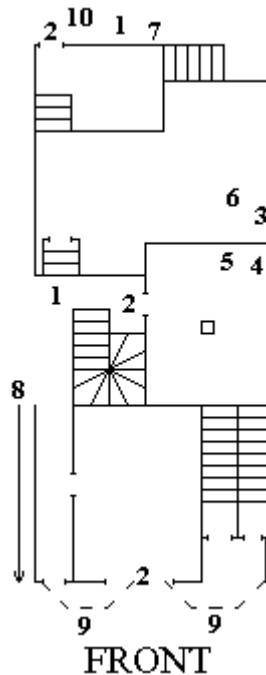

Total estimated contract price: \$24,225.00

Inspected by: Evan B. Donaldson State License No. OPR8971 Signature _____

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 1418 Howe Avenue, Suite 18, Sacramento, California, 95825-3204.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov.

DIVERSE INSPECTION SERVICES, INC.

2nd PAGE OF STANDARD INSPECTION REPORT ON THE PROPERTY LOCATED

AT:

Address of
Property
Inspection

	Connecticut Street	San Francisco, CA 94107	
Bldg. No.	Street	City	Zip
N/A	8-14-06		066730T
Stamp No.	Date of Inspection	Co. Report No.	

Please read your report in its entirety.

Inquiries regarding the content, accuracy, clarity and recommendations should be immediately referred to the inspector!

Note:

This report has been categorized into 3 different sections, which are defined as:

- (S1) Section 1 - Items where there is evidence of an active infection and/or infestation or conditions that have resulted in or from an infection and/or infestation, for example, structural repair.
- (S2) Section 2 - Items deemed likely to lead to an active infection and/or infestation, but revealed no active sign of infection and/or infestation.
- (S3) Section 3 - Further inspection; items which during the course of the original inspection did not allow the inspector access to complete the inspection and cannot be defined as (S1) & (S2).

SECTION 1 FINDINGS:

- 1) Fungus infection and damage were noted to the window sashes at the rear of the structure and in the kitchen in unit #121, where indicated. The remaining window sashes throughout the structure are weathered and/or deteriorated. (S1)
RECOMMENDATION: The owner is advised to consult with a licensed window contractor for inspection and/or correction of the windows, as needed.
- 2) Fungus infection and damage were noted to the base of the doorjamb in various locations throughout the structure, where indicated. (S1)
RECOMMENDATION: Cut off the base of the doorjamb and pack the voids with sand and cement.
- 3) Fungus infection and damage were noted to the floor in the basement bathroom, where indicated. The damage appears to extend into the interior lower associated wood-framing members below the floor. (S1)
RECOMMENDATION: Remove the existing bathroom amenities (tub, water closet, vanity, sinks, etc.). Remove the existing sheet vinyl floor covering to facilitate the repairs. Remove the damaged underlayments and framing members, as needed, and replace them with new material. Install a new sheet vinyl floor covering of similar/standard quality. Re-install the bathroom amenities.
- 4) Fungus infection and damage were noted to the upper associated wood-framing members in the basement area below the lightwell on the right side of the structure, where indicated. The roof covering for the lightwell appears to be leaking. (S1)
RECOMMENDATION: Remove the lightwell roof covering. Remove the damaged framing, as deemed necessary by Diverse Inspection Services, Inc. and replace it with new material. **Note:** The owner is responsible for contacting a licensed roofing contractor to re-roof the lightwell. Diverse Inspection Services, Inc. assumes no responsibility for future leakage.
- 5) Loose tiles and/or deteriorated wallboard were noted on the shower over-the-tub walls in the lower unit bathroom. (S1)
RECOMMENDATION: Remove the existing tiled shower wall surfaces. Remove the damaged framing members, as needed, and replace them with new material. Install a new waterproof membrane, new wallboard backing and re-tile the walls using standard 4x4 white tile. **Note:** Repairs are limited up the bathroom ceiling only and are not to extend into inaccessible areas. Additional adverse conditions, if encountered, will be reported in a supplemental report.

DIVERSE INSPECTION SERVICES, INC.

3rd PAGE OF STANDARD INSPECTION REPORT ON THE PROPERTY LOCATED

AT:

Address of
Property
Inspection

	Connecticut Street	San Francisco, CA 94107	
Bldg. No.	Street	City	Zip
N/A	8-14-06		066730T
Stamp No.	Date of Inspection	Co. Report No.	

SECTION 1 FINDINGS: (continued)

- 6) Fungus infection and damage were noted to the base trim in the rear bedroom of the upper unit, where indicated. The damaged appears to extend into the associated wood framing members. **(S1)**
RECOMMENDATION: Remove the interior wall coverings in the upper unit bedroom and lower unit bedroom, as needed, to facilitate the repairs. Remove the damaged framing, as deemed necessary by Diverse Inspection Services, Inc., and replace it with new material. Re-establish the disturbed areas to a reasonable match. **Note:** Repairs are limited to the interior associated wood framing members within the bedroom walls only and are not to extend into inaccessible areas and/or the joists. Additional adverse conditions, if encountered, will be reported in a supplemental report.
- 7) Fungus infection and damage were noted to the siding at the rear of the structure, where indicated. **(S1)**
RECOMMENDATION: Remove the damaged siding, as needed, and replace it with new material. **Note:** Repairs are limited to the siding only and are not to extend into inaccessible areas. Additional adverse conditions, if encountered, will be reported in a supplemental report.
- 8) Fungus infection and damage were noted to the mudsill in the passageway on the left side of the structure, where indicated. **(S1)**
RECOMMENDATION: Cut off the base of the wall. Install a new pressure treated sillplate, new metal supports and wood forms for the purpose of pouring a concrete stem and cap the existing foundations.
- 9) Test holes were installed through the exterior stucco at the front extended bays revealing fungus infection, an excessive moisture condition and damage to the interior associated wood-framing members. **(S1)**
RECOMMENDATION: Remove the exterior stucco, as needed, to facilitate the repairs. Repair the damaged framing. Restucco the disturbed areas to a reasonable match. Install a proper strip vent beneath the bay, which extends from one side of the bay to the other. **Note:** Repairs are limited to the undersides of the bay up to the first level windowsills only. Additional adverse conditions, if encountered, will be reported in a supplemental report with additional cost estimates for repair.
- 10) Fungus infection and damage were noted to the door at the rear of the structure, where indicated. **(S1)**
RECOMMENDATION: Remove the damaged door and replace it with a new door. **Note:** Repairs include re-using existing hardware.

SECTION 2 AND 3 FINDINGS:

- A) Several of the interior spaces were inaccessible for inspection due to storage and/or personal belongings. This inspection by nature is limited to the accessible, visible portions of the structure, and does not include inaccessible areas such as areas occupied by furnishings, storage not moved and/or the interior of hollow walls. **(S3)**
RECOMMENDATION: Further inspection of the structure by Diverse Inspection Services, Inc. is suggested upon vacancy. If this inspection is desired, it will be performed upon request, at a reasonable cost. The findings will be reported in a supplemental report.
- B) No attic access was noted. The dwelling appears to have a low profile roof. The attic area would lack sufficient clearance for an inspection and was not inspected. **(S3)**

DIVERSE INSPECTION SERVICES, INC.

4th PAGE OF STANDARD INSPECTION REPORT ON THE PROPERTY LOCATED

AT:

Address of
Property
Inspection

	Connecticut Street	San Francisco, CA 94107	
Bldg. No.	Street	City	Zip
N/A	8-14-06		066730T
Stamp No.	Date of Inspection	Co. Report No.	

SECTION 2 AND 3 FINDINGS: (continued)

- C) The siding at the rear of the structure was noted to be in slab contact. This condition is conducive to attracting future infections or infestations. However, probing the base of the siding revealed no outward sign of infection or infestation at this time. **(S2)**
RECOMMENDATION: The primary recommendation for this item is to cut off the base of the siding and omit and/or pack the voids with sand and cement. However, since no outward sign of infection or infestation is evident, no price quotation is submitted with this report.
- D) The exterior surfaces of the structure were noted to be weathered. This condition is conducive to attracting future infections or infestations. **(S2)**
RECOMMENDATION: The owner is advised to maintain the exterior surfaces in a sealed and painted condition at all times.
- E) There are no strip vents at the front extended overhang. This condition is conducive to attracting future infections or infestations. **(S2)**
RECOMMENDATION: The owner is advised to consult with the appropriate tradesman for the installation of proper strip vents which aid in ventilation as well as aid in the inspection process.
- F) The left and right sides of the structure were inaccessible for inspection due to zero-lot line clearance, therefore, were not inspected and are excluded from this report. **(S3)**
- G) Water stains were noted on the ceiling in the rear basement closet. However, no determination was made as to the origin of the moisture or whether this is an on-going condition. **(S2)**
RECOMMENDATION: The owner is advised to maintain periodic inspections and make corrections as needed.
- H) The framing below the basement room floor was inaccessible for inspection due to a lack of access. **(S3)**
RECOMMENDATION: Further inspection of this area is recommended. If this inspection is desired, it will be performed upon request, at an additional cost and will entail installing access openings in the floor in various locations. The findings will be reported in a supplemental report.
- I) Marginal to faulty grade levels were noted to the foundations at the rear of the structure. This condition is conducive to attracting future infections or infestations. However, probing the visible and accessible associated wood-framing members revealed no outward sign of infection or infestation at this time. **(S2)**
RECOMMENDATION: The primary recommendation for this item is to cut off the base of the wall. Install a new pressure treated sillplate, new metal supports and wood forms for the purpose of pouring a concrete stem and cap the existing foundation, which will elevate the foundations to the proper height. However, since no outward sign of infection or infestation is evident, no price quotation is submitted with this report. See Note 5.
- J) Delamination was noted to the kitchen countertop adjacent to the sinks in various locations. This condition is conducive to attracting future infections or infestations. **(S2)**
RECOMMENDATION: The owner is advised to maintain the countertop in a watertight condition.
- K) Corrosion was noted to the drain lines within the kitchen and bathroom areas. **(S2)**
RECOMMENDATION: The owner is advised to consult with a licensed plumber for inspection and/or correction of the plumbing lines, as needed.

DIVERSE INSPECTION SERVICES, INC.

5th PAGE OF STANDARD INSPECTION REPORT ON THE PROPERTY LOCATED

AT:

Address of
Property
Inspection

Connecticut Street		San Francisco, CA 94107	
Bldg. No.	Street	City	Zip
N/A	8-14-06		066730T
Stamp No.	Date of Inspection	Co. Report No.	

SECTION 2 AND 3 FINDINGS: (continued)

- L)** The escutcheon plates on the shower fixtures in the bathrooms were noted to be loose. This condition is conducive to attracting future infections or infestations. **(S2)**
RECOMMENDATION: The owner is advised to maintain the escutcheon plates in a caulked and sealed condition at all times.
- M)** The shower enclosure does not extend above the showerhead in the basement bathroom. This condition is conducive to attracting future infections or infestations. **(S2)**
RECOMMENDATION: The owner is advised to consult with the appropriate tradesman to extend the shower enclosure above the showerhead. In addition, the owner is advised to maintain the bathroom floor in a watertight condition.
- N)** The base of the basement entry stairs on the left side of the structure was noted to be in slab contact. This condition is conducive to attracting future infections or infestations. However, probing the base of the stairs revealed no outward sign of infection or infestation at this time. **(S2)**
RECOMMENDATION: The primary recommendation for this item is to cut off the base of the stairs and install a new masonry step. However, since no outward sign of infection or infestation is evident, no price quotation is submitted with this report.
- O)** The gutters and downspouts around the perimeter of the structure were noted to be rusting. This condition is conducive to attracting future infections or infestations. **(S2)**
RECOMMENDATION: The owner is advised to consult with a licensed sheet metal contractor for inspection and/or correction of the gutters and downspouts, as needed.
- P)** Marginal grade levels were noted to the support piers down within the middle basement area. This condition is conducive to attracting future infections or infestations. However, probing the base of the piers revealed no outward sign of infection or infestation at this time. **(S2)**
RECOMMENDATION: The primary recommendation for this item is to cut off the base of the support piers and install an elevated masonry base. However, since no outward sign of infection or infestation is evident, no price quotation is submitted with this report.
- Q)** Scattered water stains were noted in the garage/basement area in various locations. No determination was made as to the origin of the moisture or whether this is an on-going condition. **(S2)**
RECOMMENDATION: The owner is advised to maintain periodic inspections and make corrections as needed.
- R)** Some of the partition walls in the garage/basement area were noted to be in slab contact. This condition is conducive to attracting future infections or infestations. Probing the base of the walls revealed no outward sign of infection or infestation at this time. **(S2)**
RECOMMENDATION: The primary recommendation for this item is to cut off the base of the walls and install an elevated masonry base. However, since no outward sign of infection or infestation is evident, no price quotation is submitted with this report.
- S)** Further inspection of the garage area is recommended. If this inspection is desired, it will be performed upon request, at a reasonable cost and when the storage is removed and/or will entail installing access openings in the walls in various locations. The findings will be reported in a supplemental report. **(S3)**

DIVERSE INSPECTION SERVICES, INC.

6th PAGE OF STANDARD INSPECTION REPORT ON THE PROPERTY LOCATED

AT:

Address of
Property
Inspection

	Connecticut Street	San Francisco, CA 94107	
Bldg. No.	Street	City	Zip
N/A	8-14-06		066730T
Stamp No.	Date of Inspection	Co. Report No.	

SECTION 2 AND 3 FINDINGS: (continued)

- T)** Loose and/or missing grout were noted on the tiled surfaces within the kitchen and bathroom areas. This condition is conducive to attracting future infections or infestations. **(S2)**
RECOMMENDATION: The owner is advised to periodically inspect and/or maintain all the tiled surfaces within the kitchen and bathroom area and properly caulk, grout and/or seal the tiles on a regular basis.
- U)** The water closet in the bathrooms were noted to be loose. This condition is conducive to attracting future infections or infestations. **(S2)**
RECOMMENDATION: The owner is advised to consult with a licensed plumber to secure the toilet to the floor.
- V)** Water stains were noted on the wall beneath the window in the rear bedroom in the upper unit. This condition is conducive to attracting future infections or infestations. **(S2)**
RECOMMENDATION: The owner is advised to maintain the exterior surfaces in a watertight condition and maintain the windowsills and jambs in a sealed and painted condition at all times.
- W)** Water stains were noted on the windowsills and jambs in various locations throughout the structure. This condition is conducive to attracting future infections or infestations. **(S2)**
RECOMMENDATION: The owner is advised to maintain the windowsills and jambs in a sealed and painted condition at all times.
- X)** Mold and mildew were noted on the walls/ceilings within the bathroom areas and in the basement. This is an indication of a lack of ventilation and may contribute to attracting future infections or infestations. **(S2)**
RECOMMENDATION: The owner is advised to maintain proper ventilation techniques to alleviate this condition.
- Y)** Water stains were noted on the ceiling in the stairwell for the upper unit. However, no determination was made as to the origin of the moisture or whether this is an on-going condition. The roof, however, is suspect. **(S2)**
RECOMMENDATION: The owner is advised to maintain periodic inspections and make corrections as needed. In addition, consult with a licensed roofing contractor for inspection and/or correction, as needed.
- Z)** The thresholds at the rear entries were noted to be pitched backwards and may allow for water intrusion. **(S2)**
RECOMMENDATION: The owner is advised to consult with an appropriate tradesman with regards to repairs to the thresholds.
- AA)** The rear deck/stair assembly is not attached to the main structure and poses no structural threat, therefore, was not inspected and is excluded from this report. **(S3)**
- BB)** The tiles on the floor in various locations were noted to be broken and/or loose. This condition is conducive to attracting future infections or infestations. **(S2)**
RECOMMENDATION: The owner is advised to maintain the floor in a watertight condition. In addition, consult with a licensed tile contractor for inspection and/or correction of the tiles, as needed.
- CC)** Efflorescence was noted on the foundation walls in various locations. This is an indication of exterior forms of water penetration and is a condition conducive to attracting future infections or infestations. **(S2)**
RECOMMENDATION: The owner is advised to maintain periodic inspections and make corrections as needed. In addition, consult with a licensed structural and/or soil engineer for further information.

DIVERSE INSPECTION SERVICES, INC.

7th PAGE OF STANDARD INSPECTION REPORT ON THE PROPERTY LOCATED

AT:

Address of
Property
Inspection

_____		Connecticut Street	San Francisco, CA 94107	
Bldg. No.	Street	City	Zip	
_____		8-14-06	066730T	
Stamp No.	Date of Inspection	Co. Report No.		

SECTION 2 AND 3 FINDINGS: (continued)

DD) Deterioration and/or excessive moisture were noted to the foundations in various locations. This condition is conducive to attracting future infections or infestations. **(S2)**

RECOMMENDATION: The owner is advised to consult with a licensed structural and/or soil engineer for further evaluation of the foundations, as needed.

Notes:

Note 1:

All disturbed areas will be treated during the course of corrections. All recommendations are contingent upon the approval of the local building department.

Note 2:

Any work performed by outside contractors must have exposed wood framing members to properly qualify for certification prior to the installation of new wood framing members and/or finished interior and/or exterior wall surfaces. The certification statement basically indicates that no further active infection or infestation is located within the areas previously indicated above and does not include areas which may be inaccessible at the time of this inspection such as areas with storage, furnishings and/or closed walls and ceilings.

Note 3:

A certification is only given when said work is done with benefit of permit when applicable.

Note 4:

All of the items above involving structurally related repairs, which may affect the finished wall surfaces, do not include any painting. The owner is advised to consult with a licensed waterproofing contractor to properly caulk, prime and paint the exterior to maintain it in a watertight condition.

Note 5:

All items referencing to Section II items which revealed no outward sign of infection or infestation where visibly probed can be further inspected upon request, at a reasonable cost and will entail accessing these areas by removing wall coverings, storage, furnishings, and/or sections of support framing and/or through the installation of bore/test holes. This type of inspection is beyond the normal scope of the inspection originally performed. These types of inspections are performed on a time and material basis. The findings would be reported in a supplemental report.

Note 6:

Separate estimates/contracts will be drawn for items listed above upon request. Please call.

DIVERSE INSPECTION SERVICES, INC.

8th PAGE OF STANDARD INSPECTION REPORT ON THE PROPERTY LOCATED

AT:

Address of
Property
Inspection

	Connecticut Street	San Francisco, CA 94107	
Bldg. No.	Street	City	Zip
N/A	8-14-06		066730T
Stamp No.	Date of Inspection	Co. Report No.	

Disclaimers:

1. This report is not a guarantee stating that all the area of possible infestation and/or infections within the structure have been identified. Water damage and/or pest infestation may also be concealed in enclosed walls and/or other areas not made accessible at the time of the inspection.
2. If you do not understand any portion of this report, refrain from use of report for any reason until you do understand. Please call for any explanations or enlightenment desired prior to report's use.
3. Your signature on contract is your acceptance of the report in its entirety, and all provisions as stated and is your agreement to meet and abide by contract with no other provisions unless in writing and signed by all parties in interest.
4. Your signature on contract accepts fact that we, (Diverse Inspection Services, Inc.), accept no responsibility for areas that are hidden to view by closed and finished walls, ceilings, or areas that are occupied by furnishings, storage or are otherwise concealed with no outward sign of infection or infestation. See structural pest control Regulations TITLE 16 ARTICLE 6 SECTION 1990 ITEM J.
5. Attics are inspected per structural pest control regulations, when a release for damages that may occur to finished ceilings during course of inspection is received and at an additional charge.
6. Infected, infested findings are bid by price - noninfected, non-infested items (conductive items), are mentioned on report and recommendations are made, but are not usually bid, unless requested.
7. Further inspections requiring carpentry to open and/or reclose areas are performed at an additional cost, and are left to the judgment of Diverse Inspection Services, Inc. as to what, where and at what cost further inspections will be performed.
8. Areas subject to moisture and not included in this report as such as, roofs, decorative and structural metal, exterior and interior finishes windows/doors, seepage through foundations, unless specific or mentioned in body of report are home owner's responsibility and should be maintained through home maintenance procedures.
9. Windows are checked for infection/infestation where they are readily accessible from interior and exterior. No furnishings or storage are moved to facilitate inspection and those areas are considered by necessity inaccessible. Inspection of those areas will be performed once furnishings and/or storage is removed, or relocated.
10. All areas treated or repaired by Diverse Inspection Services, Inc. for infestation or infections are warranted for one year.
11. Price quotations are subject to change at 30 days from issuance of original report. Diverse Inspection Services, Inc. reserves the right to reinspect any property where ninety days have elapsed from date of original report, if deemed necessary. This is not a contract to perform work off of this report. If you wish to have Diverse Inspection Services perform any repairs list in this report, please call us immediately.
12. Reinspection of properties where work has been performed by other than Diverse Inspection Services, Inc. will be performed as outlined in structural pest control regulations at a fee rate no higher than the original inspection fee, with exception to any areas where Diverse Inspection Services, Inc. deems it necessary to request further inspection, which will be performed on a current hourly basis plus materials required to close and refinish disturbed areas.

DIVERSE INSPECTION SERVICES, INC.

9th PAGE OF STANDARD INSPECTION REPORT ON THE PROPERTY LOCATED

AT:

Address of
Property
Inspection

Connecticut Street		San Francisco, CA 94107	
Bldg. No.	Street	City	Zip
N/A	8-14-06		066730T
Stamp No.	Date of Inspection	Co. Report No.	

Disclaimers: (continued)

13. Plants, bushes, trees, and lawns disturbed during the course of construction, will be the owner's responsibility to replace, unless otherwise specified in the report or contract.
14. If contractor raises the building or any part thereof; or increases foundation heights, he shall not be liable for any damage to said building or parts thereof, including cracks in plaster, walls, wiring, pipes, windows or any other damage occasioned by said raising.
15. This inspection by nature is limited to accessible, visible portions of structure, and does not include inaccessible areas such as areas occupied by furnishings and/or storage not moved, the interior of hollow walls, spaces between a floor or porch deck, the ceiling or soffit below, stall showers over finished ceilings, structural segments as porte cocheres, enclosed bay windows, buttresses and similar areas which have no access without defacing or tearing out lumber, masonry or finished work such as cabinet work, floors beneath coverings or areas locked unless conditions are noted otherwise in body of report. Areas deemed likely to hold hidden infestation and/or infection if any, are identified and further inspection will be performed upon request if needed. If this inspection is desired for any of these areas, it will be performed upon request, at an additional cost. The findings will be reported in a supplemental report.
16. The exterior surfaces of the roof were not inspected. No determination was made as to the water tightness of the roof. If further information is desired regarding the conditions, life expectancies, and costs for repair and/or replacement of the roof, it is advised that a licensed roofing contractor be contacted.
17. The roof eaves were not inspected during the course of this inspection and are excluded from this report, as are all areas, which are considered out of normal reaching distance, and/or areas, which would require a ladder, scaffold, etc. If desired, further evaluation of these areas will be performed at an additional cost. The findings will be reported in a supplemental report.
18. This inspection was performed from the ground level only. The remaining exterior surfaces, from the inspector's reach to the roof, were visually inspected only with conditions stated in the finding and recommendation section of the report. This does not warrant that every adverse condition will be observed from the ground level. A ladder can be positioned in various locations against the walls to gain access to areas defined as inaccessible, which normally exceeds the scope of this original inspection. If this inspection is desired, it will be performed upon request, at a reasonable cost and the findings will be reported in a supplemental report.
19. **NOTICE: ...Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company...You...have a right to seek a second opinion...from another company.**
20. An estimate will be provided for most if not all Section 1 items. This estimate is provided as a courtesy and in our opinion is competitive if not lower than most competitors. It is advised that qualified persons provide additional estimate for comparison based off the items mentioned in the report. There should not be any additional hidden cost once work begins for repair except for those items in the report that are limited to the scope of repairs to a specific location. Other contractors may low-ball the dollar amounts and/or not have a complete understanding as to the complexities regarding the requirements pass down by the Structural Pest control Board. For your safety be advised that all contractors should be licensed, have workmen's compensation and liability insurance.

DIVERSE INSPECTION SERVICES, INC.

FINAL PAGE OF STANDARD INSPECTION REPORT ON THE PROPERTY LOCATED

AT:

Address of
Property
Inspection

Connecticut Street		San Francisco, CA 94107	
Bldg. No.	Street	City	Zip
N/A	8-14-06	066730T	
Stamp No.	Date of Inspection	Co. Report No.	

San Francisco
County

ONLY!

State law requires that you be given the following information:

CAUTION: PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Operations are licensed and regulated by the Structural Control Board and apply pesticides where are registered and approved for use by the California Department of Food and Agriculture and Environmental Protection Agency. Registration is granted when the State finds that based on existing scientific evidence there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure so exposure should be minimized.

If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center and your Pest Control Operator immediately.

For further information, contact any one of the following:

Your Pest Control Operator (Diverse Inspection Services, Inc.)	(415) 665-8288
For Health Questions: County Health Department	(415) 554-2500
For Application Information: The County Agriculture Commissioner	(415) 824-6100
For Regulatory Information: The Structural Pest Control Board	(916) 561-8708 – (800) 737-8188
1430 Howe Avenue	
Sacramento, CA 95825	

The pesticide or pesticides to be used and the active ingredients are:

- | | |
|--|--|
| <p><input checked="" type="checkbox"/> COPPER NAPHTHANATE 20
Active ingredient 20%
Inert ingredients 80%
E.P.A. Reg. #9630-17-9639</p> | <p><input type="checkbox"/> TIM-BOR
Active ingredients:
Disodium Octaborate Tetrahydrate 98%
Inert ingredients 2%
E.P.A. Reg. #1624-39
E.P.A. Est. #1624-CA-1</p> |
| <p><input type="checkbox"/> BORA - CARE
Active ingredients:
Disodium Octaborate Tetrahydrate 40%
Inert ingredients 60%
E.P.A. Reg. #64405-1
E.P.A. Est. #64405-TN-1</p> | <p><input type="checkbox"/> DURSBAN PT 270
Active ingredients:
Chlorpyrifos .5%
Inert ingredients 99.5%
E.P.A. Reg. #499-147
E.P.A. Est. #499-MO-1</p> |
| <p><input type="checkbox"/> DEMON MAX
Active ingredients:
Cypermethrin 25.3%
Inert ingredients 74.7%
E.P.A. Reg 100-1218</p> | |